NISSAN NORTH AMERICA, INC.
Copyright ©

SERVICE BULLETIN

Classification:	Reference:	Date:
BT05-025a	NTB05-042a	June 28, 2005

WINDOW REGULATOR CREAK NOISE AFTER OPENING

This bulletin amends NTB05-042. Please discard all paper copies of that bulletin.

APPLIED VEHICLE(S):

2005 Pathfinder (R51), Frontier (D40), Xterra (N50)

2004 Sentra (B15) with QG 18 engine built **after** 3N1CB51D84L881547and November 10, 2003

2004 Sentra (B15) with QR25 engine built **after** 3N1AB51DX4L734511 and November 11, 2003

2005 Sentra (B15) with QG 18 engine built **before** 3N1CB51D35L563031 and May 6, 2005

2004 Sentra (B15) with QR25 engine built **before** 3N1AB51D5L563085 and May 6, 2005.

IF YOU CONFIRM

There is a creak noise during window movement after the window is opened approximately a quarter of the way from the fully closed position.

OR

The window glass continues to move down slightly after the window button is released and makes a creak noise.

ACTION

Remove the window regulator and apply Genuine Nissan Window Regulator Grease to the specific locations of the slide rail as shown in the Service Procedure.

IMPORTANT: The purpose of “ACTIONS” (above) is to give you a quick idea of the work you will be performing. You MUST closely follow the entire Service Procedure (starting on page 2) as it contains information that is essential to successfully completing this repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
Genuine Nissan Window Regulator Grease (1) (2)	999MP-WRG00P	1

1. This grease must be ordered through the Nissan Direct Ship Chemical Care Product Program: Phone 1.800.811.0502, Fax 1.770.218.0148, Website *www.NissanChemicals.com.*
2. This tube will service multiple windows/vehicles and is considered a shop supply – do NOT claim it on your warranty claim.

CLAIMS INFORMATION

Submit a Primary Failed Part (PP) line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
RPL/R&I One Window Regulator	(1)	UH23AA (3)	ZL	21	(2)

1. Reference the respective vehicle Parts Catalog and use the indicated window regulator P/N as the PFP.
2. Reference the current Nissan Warranty Flat Rate Manual and use the indicated FRT.
3. **If** required, this Op Code may be claimed twice on the same line.

SERVICE PROCEDURE

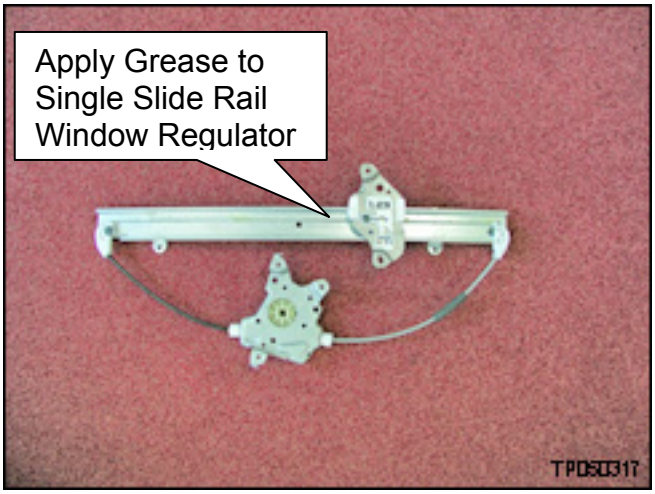

Figure 1

NOTE: GENUINE NISSAN WINDOW REGULATOR GREASE is the **ONLY** approved grease for this repair if Nissan is paying for the repair. This includes warranty, service contract and goodwill. Such a claim may be denied if GENUINE NISSAN WINDOW REGULATOR GREASE is not used as specified in this bulletin.

1. Remove the front door glass regulator assembly from the side that is making noise.
   - Refer to the Electronic Service Manual (ESM), section GW, for removal instructions.
2. Clean/wipe off all of the old existing grease from the front window regulator slide rail.

3. Apply Genuine Nissan Window Regulator Grease (see Parts Information) to the entire length of the front window regulator slide rail as shown. (See Figure 2).

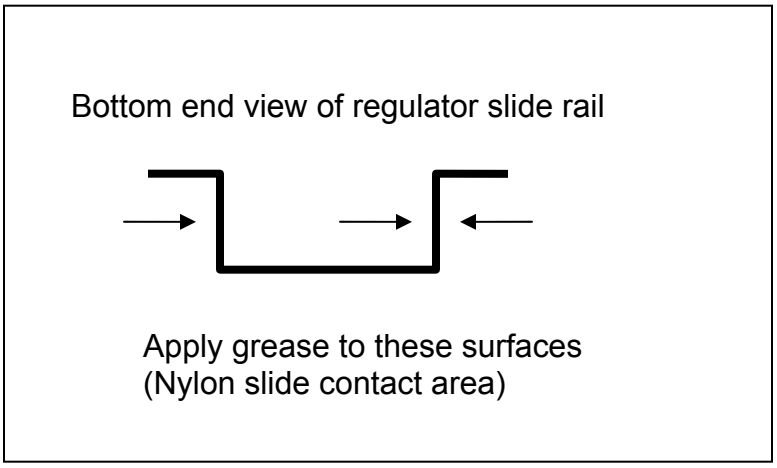

Figure 2

4. Reinstall the glass regulator assembly and any other parts that were removed in the reverse order of assembly.